



This MotoCAP safety rating applies to:

Brand Ixon Model Torque


Type Jacket - Leather
Date purchased 3 April 2023
Sizes tested M and XL
Test garment gender Male
Style All Purpose
RRP \$599.95

Test Results Summary	Rating	Score
MotoCAP Protection Rating	***	50.6
Abrasion	5/10	4.11
Burst	10/10	1431
Impact	7/10	52.3
MotoCAP Breathability Rating	+	0.118
Moisture Vapour Resistance	-	147.5
Thermal Resistance	-	0.290
Water resistance	1/10	33.7

This garment is fitted with impact protectors for the elbows and shoulders. A pocket is provided for an aftermarket back protector. There are zipped vents in the chest and perforated leather located in the back of neck to allow controlled airflow movement through the garment. The breathability rating is based on tests of the garment's materials when all vents are closed. The breathability of this product may be better when the vents can be opened. Breathability was measured without the removable thermal liner installed.

Jacket and Pants - Crash Impact Risk Zones

This diagram is a pictorial representation of the crash impact risk Zones.

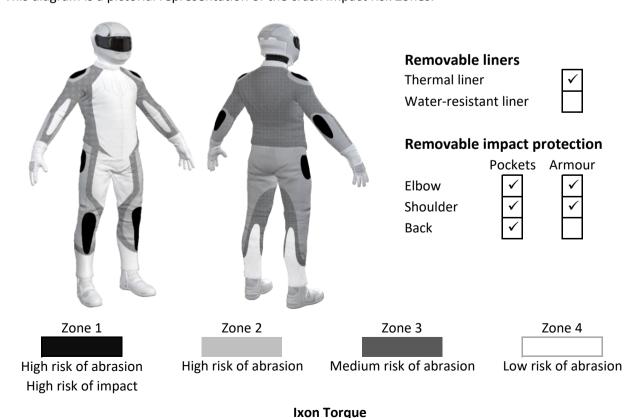



Abrasion Resistance

The jacket was tested for abrasion resistance in accordance with MotoCAP test protocols. The diagram below is a visual indication of the likely abrasion performance of the materials in each zone calculated from the data in the table below. The colour coding is based on the worst performing material in each zone.



Abrasion Resistance Performance

Abrasion rating	5/10
Abrasion score	4.11

Determining Criteria	Area	Good	Acceptable	Marginal	Poor
High abrasion risk	Zones 1 & 2	> 5.6	3.0 - 5.6	1.3 - 2.9	< 1.3
Medium abrasion risk	Zone 3	> 2.5	1.8 - 2.5	0.8 - 1.7	< 0.8
Low abrasion risk	Zone 4	>1.5	1.0 - 1.5	0.4 - 0.9	< 0.4

Individual Abrasion Resistance Results: - The table below shows the test results for time to abrade through all layers of the materials. Calculated for each sample by Zone, type and area coverage of each material as a proportion of that Zone. Abrasion times are capped at a maximum of 10.00s.

Abrasion time for each test (seconds)

Aprasion time t	or each test (se	conas)							
Zones 1 & 2	Coverage (%)	Sample 1	Sample 2	Sample 3	Sample 4	Sample 5	Sample 6	Average	
Material A	60%	3.73	5.65	3.75	4.95	4.58	4.79	4.58	Α
Material B	40%	3.38	6.98	3.55	2.22	3.64	3.43	3.87	Α
Zone 3	Coverage (%)	Sample 1	Sample 2	Sample 3	Sample 4	Sample 5	Sample 6	Average	
Material B	100%	3.38	6.98	3.55	2.22	3.64	3.43	3.87	G
Zone 4	Coverage (%)	Sample 1	Sample 2	Sample 3	Sample 4	Sample 5	Sample 6	Average	
Material B	100%	3.38	6.98	3.55	2.22	3.64	3.43	3.87	G

Details of materials used in jacket

Material A	Quilted leather shell, water-resistant layer and fabric inner liner
Material B	Leather shell, water-resistant layer and fabric inner liner



Burst Strength

The jacket was tested for burst strength in accordance with MotoCAP test protocols. The diagram below illustrates the burst strength results in terms of the likely performance of the garment in an impact and is a pictorial representation of the data from the table below.



Burst Strength Performance

Burst rating	10/10
Burst score	1431

Determining Criteria	Unit	Good	Acceptable	Marginal	Poor
Burst strength	(kPa)	> 1000	800 - 1000	500 - 799	< 500

Individual Burst Strength Results: - The table below shows the burst pressure in kilopascals (kPA) for each sample tested by Zone and the average result for each zone.

Burst pressure for each seam (kPA)

Area	Sample 1	Sample 2	Sample 3	Sample 4	Sample 5	Sample 6	Average	
Zones 1 & 2	1380	1418	1413	1442	1447	1644	1457	G
Zones 3 & 4	1791	1572	1079	1614	794	1099	1325	G



Impact Protection

The jacket was tested for impact protection and coverage in accordance with MotoCAP test protocols. The diagram below is a visual indication of the likely performance of each impact protector calculated from the data in the table below. The colour coding is based on the worst performing score for average or maximum force for each impact zone. Areas shaded black are not considered for impact protection ratings.



Impact Protection Performance

Impact rating 7/10 Impact score 52.3

Determining Criteria	Unit	Good	Acceptable	Marginal	Poor*
Impact force	(kN)	< 15	15 - 24	25 - 30	> 30

^{*} Poor may also indicate that no impact protector, or impact protector pocket is present in the garment

Impact Protector Results: - The table below shows the average and maximum force transmitted through each impact protector type in kilonewtons (kN) and their area of coverage as a proportion (%) of the Zone.

Impact protector type	Elbow		Shoulder
Average force (kN)	11.4	G	11.4 G
Maximum force (kN)	15.6	A	15.6 A
Coverage of Zone 1 area	90%		100%
Coverage of Zone after displacement	80%		100%

Individual Impact Protector Results: - The table below shows the test results for each strike on individual impact protectors in kilonewtons (kN) and the position of the strike. Individual strike results are capped at a maximum of 50kN.

Force transfer for each impact strike (kN)

Impact protector type	Elbow	Elbow Shoulder				
Strike location	Centre	Mid	Edge	Centre	Mid	Edge
Impact Protector 1	9.7	11.5	11.3	9.7	11.5	11.3
Impact Protector 2	9.8	10.5	15.6	9.8	10.5	15.6
Impact Protector 3	10.3	9.8	14.2	10.3	9.8	14.2



Breathability

The jacket was tested for breathability following the MotoCAP test protocols. The table below shows the moisture vapour resistance and the thermal resistance values obtained.

Without removable I	iners	With	n water-resista	ant liner
Breathability rating		Brea	thability rating	N/A
Breathability score	0.118	Breathability score		N/A
Moisture Vapour Resi	stance - R _{et} (kPa.m²/W)	1	2	Average
Without removable liner	S	144.4	150.7	147.5
With water-resistant line	er	N/A	N/A	N/A
Thermal Resistance -	R _{ct} (K.m²/W)	1	2	Average
Without removable liner	S	0.294	0.286	0.290
With water-resistant line	er	N/A	N/A	N/A

Water spray and rain resistance

This jacket is advertised as water-resistant, and so has been tested for water spray and rain resistance according to the MotoCAP test protocols. The table below shows the water absorbed (ml) and the wetting proportion (%) of the garment and undergarments due to water absorption.

	Water absorbed by garment		Water absorbed by underwear	
	Volume (ml)	Percentage (%)	Volume (ml)	Percentage (%)
Jacket 1	765	37%	103	37%
Jacket 2	1687	73%	94	31%
Average	1226	55%	98	34%

Location of wetting

There was major wetting to the cotton underwear present at the neck and chest for both jackets tested.

Assessment Details.

Brand Ixon Model Torque

Type Jacket - Leather Date purchased 3 April 2023

Tested by AMCAF, Deakin University Report approved by MotoCAP Chief Scientist

Garment test reference J23L06
Rating first published June 2023
Rating updated 9 June 2023